CROSS COUNTRY

CROSS COUNTRY HOME INSPECTIONS, LLC 9723108320 jason@xcinspections.com https://www.xcinspections.com



TREC REI 7-6

1234 Main Street Blessing TX 77419

Buyer Name 07/17/2023 9:00AM



Inspector Jason Lewis TREC License #25963 9723108320 jason@xcinspections.com



Agent Agent Name 555-555-5555 agent@spectora.com



PROPERTY INSPECTION REPORT FORM

Buyer Name	07/17/2023 9:00AM
Name of Client	Date of Inspection
1234 Blessing TX 77419	
Address of Inspected Property	
Jason Lewis	TREC License #25963
Name of Inspector	TREC License #
Name of Sponsor (if applicable)	TREC License #

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILTY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

<u>Conditions may be present in your home that did not violate building codes or common practices in effect when the home</u> was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

In Attendance: None Occupancy: Vacant Style: Contemporary Temperature (approximate): 75 Fahrenheit (F) Type of Building: Attached, Single Family Water Source: Public Sewer Type: Public Weather Conditions: Cloudy, Recent Rain

Report Identificati	on: 1234 Main Street Bless	ing TX 77419 - 09/30/2021		
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

I. STRUCTURAL SYSTEMS


🛛 🗆 🖾 A. Foundations

Type of Foundation(s): Concrete, Slab on Grade *Comments:*

1: Corner Pop

Maintenance Item

One or more of the foundation perimeter corners were observed to be sheared off (corner pop). This is a common condition and is due to thermal expansion and contraction of the different building materials. This condition does not adversely affect the foundation performance. However, in some cases, some cosmetic improvements may be necessary.

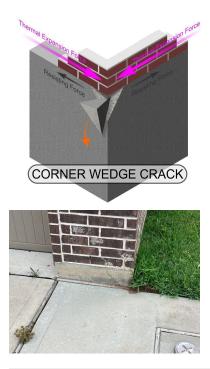

Recommendation: Contact a qualified concrete contractor.

2: Heaving/Settling Recommendation

The floor slab and exterior masonry shows some minor signs of movement/settling due to soil movement. No signs of movement were apparent in the drywall at the time of the inspection. I recommend monitoring for further movement and hiring a qualified structural engineer to evaluate and advise on how to remedy.

Recommendation: Contact a qualified structural engineer.

I=Inspe	cted		NI=Not Inspected	NP=Not Present	D=Deficient	
I NI	NP	D				





3: Planting Beds Near Foundation Recommendation

Watering of plants installed along the home exterior walls will introduce moisture in the soil next to the foundation. This home is located in an area known to have expansive soils. Expansive soils are soils that expand in volume as soil moisture content rises. This expansion has the capacity to damage foundations if building methods to accommodate it have not been used. The Inspector recommends removal of the planters and replacement of existing plants with plants have low water requirements.

Recommendation: Contact a qualified landscaping contractor

Report Identification: 1234 Main Street Blessing TX 77419 - 09/30/2021

I=Inspected NI=Not Inspected	NP=Not Present	D=Deficient	
------------------------------	----------------	-------------	--

I NI NP D



B B B Grading and Drainage *Comments:*

X

□ □ □ C. Roof Covering Materials *Types of Roof Covering:* Asphalt



Viewed From: Ground, Ladder *Comments:*



D. Roof Structures and Attics

Viewed From: Attic Approximate Average Depth of Insulation: 14 Inches

Page 5 of 17

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient



Comments:

1: Poor Rafter Top Cuts Recommendation

Plumb cuts where some rafters connect to the ridge were badly cut, leaving gaps. This condition reduces the strength of these connections. An evaluation and improvements should be made by a qualified framing contractor.

Recommendation: Contact a qualified general contractor.



I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
-------------	------------------	----------------	-------------	--



■ □ □ E. Walls (Interior and Exterior)

Comments:

Vegetation Too Close to Structure:

Vegetation around the exterior walls was overgrown and needed to be cut back. This condition limited the ability to perform a thorough inspection in this area of the structure.

1: Mold

Recommendation

Observed signs of previous water intrusion/mold on the east wall of the garage. No active leaks were identified at the time of inspection. Recommend monitoring for active leaks and identifying source of moisture intrusion and sending samples to a lab for testing.


Recommendation: Contact a qualified mold inspection professional.



2: Vegetation Too Close to the Building Maintenance Item

Vegetation around the exterior walls was overgrown and needed to be cut back. Chance of water damage, finishes and contents. Chance of pests entering the building. I recommend trimming back all vegetation a minimum of 1 foot from the exterior walls.

Recommendation: Contact a handyman or DIY project

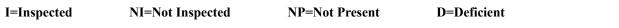



3: Caulking Missing

Maintenance Item

All exterior electrical boxes and vents should be caulked to prevent water intrusion.

Recommendation: Contact a handyman or DIY project



4: Inadequate Clearance From Roof Clearance From Roof

The exterior wall-covering material terminated too close to the roof-covering material at headwalls. Good building practice requires a gap of 1.5 inches minimum between the bottom of exterior wall-covering material and the top of the roof-covering material.

Recommendation: Contact a qualified professional.



R	eport	Identi	ificati	on: 1234 Main Street Blessing TX 77419 - 09/30/2021
I=I	nspec	cted		NI=Not Inspected NP=Not Present D=Deficient
Ι	NI	NP	D	
X				F. Ceilings and Floors <i>Comments:</i> No flooring installed in any of the bedrooms or office.
X			X	G. Doors (Interior and Exterior) Comments:
				 1: Door Doesn't Latch Maintenance Item Garage Garage entry door is self closing but doesn't latch properly. Recommend handyman adjust latch and/or strike plate. Recommendation: Contact a qualified handyman. 2: Door Doesn't Latch Maintenance Item Front Entry Front door doesn't latch properly. Recommend handyman repair latch and/or strike plate. Recommendation: Contact a qualified handyman. 3: Door Doesn't Latch Maintenance Item Office Double Doors to office don't latch properly. Recommend handyman repair latch and/or strike plate.
X				H. Windows Comments:
		X		I. Stairways (Interior and Exterior) Comments:
×				J. Fireplaces and Chimneys Comments:
X				K. Porches, Balconies, Decks, and Carports Comments:

Report Identification: 1234 Main Street Blessing TX 77419 - 09/30/2021I=InspectedNI=Not InspectedNP=Not PresentD=Deficient

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels *Comments:*

NI

I

NP

D



Service Entrance Rating: 125 Amps

1: Improper Color Coding Recommendation

The hot (energized) conductors in a branch circuit are only allowed to be black or red. I recommend a qualified electrician properly identify the conductors inside the main panel and auxiliary panels.

Recommendation: Contact a qualified electrical contractor.



 Image: Second system
 Image: Second system

 Image: Second

1: Exposed Ends & Splices

ASafety Hazard

North Exterior Wall

All wire connections & energized wires with exposed ends and splices should be covered in junction boxes for safety. Exposed energized wires were found on the north exterior wall. I recommend a qualified electrician correct this safety concern.

Recommendation: Contact a qualified electrical contractor.

Page 10 of 17

I=Inspected NI=Not Inspected NP=Not Pre	esent D=Deficient
---	-------------------



Energized electrical wires

2: Light Fixture - Exposed to Mechanical Damage (No Cage or Protective Lens)

Recommendation Kitchen Pantry

Recommendation: Contact a qualified professional.



3: Light Fixture/Ceiling Fan - Inoperable

Maintenance Item

,Front Porch

The light fixture and ceiling fan in the living room is not operating. The light flickers when the switch is operated but does not stay on. I recommend a licensed electrician evaluate and repair.

Recommendation: Contact a qualified electrical contractor.

4: Light Fixture - Inoperable

Maintenance Item

Front Porch

One or more lights are not operating. New light bulb possibly needed.

Recommendation: Contact a qualified electrical contractor.

$\Box \quad \Box \quad \boxtimes \quad \Box \quad C. \text{ Other}$

Comments:

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

X A. Heating Equipment

Type of Systems: Gas-Fired Heat



Energy Sources: Natural Gas Comments: Supply Temperature: Fahrenheit -99.3





X **B.** Cooling Equipment

Type of Systems: Electric, Central Air Conditioner Comments:



1: Temperature Split Across Cooling Coil Less Than 15 degrees Fahrenheit

Page 12 of 17

X

✤Maintenance Item

I

Recommendation: Contact a qualified HVAC professional.



70 degrees at return

59.4

58.6





X

C. Duct Systems, Chases, and Vents Comments:

D. Other Comments:

Report Identificati	ion: 1234 Main Street Bless	ing TX 7/419 - 09/30/2021		
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

IV. PLUMBING SYSTEMS

■ □ □ A. Plumbing Supply, Distribution Systems, and Fixtures

Location of Water Meter: Exterior Front yard on the left (north) side of the lot. Location of Main Water Supply Valve : North Exterior Wall



Type of Supply Piping Material: PVC *Comments:*

Static Water Pressure Reading: 48 psi



- B. Drains, Wastes, and Vents

 Type of Drain Piping Material: PVC

 Comments:
- Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Constraint of the second system

 Image: Constraint of the second system
 Image: Consecond system

 <t

1: Discharge tube missing 6" metal lead-out Recommendation

X

The T&P (Test and Pressure) valve on water heater needs a 6 inch metal pipe lead-out immediately after the valve before being connected to CPVC pipe. In it's current state the PVC will detach from the unit if a discharge occurs. CPVC T&P valve discharge piping cannot withstand today's standards. The max temperature rating for CPVC piping is 180 degrees F, the T&P will lift/discharge at 210 degrees. Due to this process it is recommended that the first 6-12" of discharge from the T&P valve should be plumbed with copper piping which is better equipped to handle the temperature of discharge. Recommend having licensed plumber evaluate.

Recommendation: Contact a qualified professional.



- **D. Hydro-Massage Therapy Equipment** *Comments:*
- Image: Construction Construction Systems and Gas Appliances

 Location of Gas Meter: South Exterior Wall

 Type of Gas Distribution Piping Material: Steel

 Comments:

	eport I nspe o		ificati	ion: 1234 Main Street Blessing TX 77419 - 09/30/2021 NI=Not Inspected NP=Not Present D=Deficient
Ι		NP	D	
				V. APPLIANCES
X				A. Dishwashers Comments:
X				B. Food Waste Disposers Comments:
X				C. Range Hood and Exhaust Systems Comments:
				<section-header></section-header>
				<section-header></section-header>

- **EXAMPLE 1 F. Mechanical Exhaust Vents and Bathroom Heaters** *Comments:*
- **G. Garage Door Operators** *Comments:*
 - □ □ **H. Dryer Exhaust Systems** Comments:

 \mathbf{X}

Report Identification: 1234 Main Street Blessing TX 77419 - 09/30/2021

ected NI=Not Inspected NP=Not Present D=Deficie

I NI NP D

